

- Subject : Check of ignition timing after exchange of an electronic box
- Affected : All motor glider engines type 535, all executions
- Reason : Ignition timing may change after exchange of an electronic box.
- Measures : 1) Check ignition timing with a strobe light, see manual page 11.
2) Values: ^{→ .055"} 1,36 +/-0,25 mm B.T.D.C. = 15° B.T.D.C., see also marks on crankcase and startergear
3) For correction, move armature plate. In case of different values, the higher value must correspond to the specifications.

Gunskirchen, 1988 08 23



Approved by

Bundesamt für Zivilluftfahrt

20 -09- 1988

A. 

